



•8786 Sonoma Coast Drive, Winter Garden, FL 34787
•(407)614-4572 Office
•(814)243-1927 Cell
•dkenvironmental@yahoo.com
•www.dk-environmental.com

©2024 DK Environmental & Construction Services, Inc. All rights reserved.

**LEAD-BASED PAINT
RISK ASSESSMENT REPORT**

PREPARED FOR THE FOLLOWING PROPERTY:



1010 SW 5th Street
Ocala, FL 34471

PERFORMED ON:
August 13, 2024

PERFORMED AND PREPARED BY:

Debra Koontz
Debra Koontz
Certified Risk Assessor
LBP-R-I191376-3

TABLE OF CONTENTS

- I. Cover Letter**
- II. Executive Summary**
- III. Scope of Inspection**
 - A. Building Background
 - B. Preface
 - C. Training
 - D. Equipment
 - E. Inspection Company
 - F. Methods
 - G. Findings
 - H. Conclusions
 - I. Lead Dust/Soil Hazards
 - J. Recommendations and Options
- IV. Disclosure Responsibility and Disclaimer**
- V. XRF Results**
- VI. Drawings/Floor Plans**
- VII. Property Photographs**
- VIII. Risk Assessment Forms**
- IX. License/Certification**
- X. XRF Performance Characteristic Sheet**
- XI. Glossary**
- XII. Laboratory Results**

Confidentiality Notice: This Report is intended only for the use of the individual or entity addressed, and may contain information that is privileged, confidential, and exempt from disclosure under applicable law. If you are not the intended recipient or responsible for delivering this report to the intended recipient, you are hereby notified that any dissemination, distribution, or copying of this report, in whole or in part, is prohibited. If you have received this report in error, please notify us immediately. Thank you.



•8786 Sonoma Coast Drive, Winter Garden, FL 34787
•(407)614-4572 Office
•(814)243-1927 Cell
•dkenvironmental@yahoo.com
•www.dk-environmental.com

August 17, 2024

Re: Lead-Based Paint Inspection/Risk Assessment Report

Property Address: **1010 SW 5th Street, Ocala, FL 34471**

Property Owner: **Sheryl Roberts**

Phone: **352-304-4266**

Dear Client:

Please find enclosed the lead inspection/risk assessment report for the property located at **1010 SW 5th Street, Ocala, FL 34471**. The survey was performed within the current acceptable industry guidelines, Housing and Urban Development (HUD) Guidelines Chapter 7 (revised 1997) and EPA regulations.

DK Environmental & Construction Services, Inc. (DKE) conducted the lead-based paint inspection services at the above-referenced site on **August 13, 2024**.

DKE used an RMD LPA-1 X-Ray Fluorescence (XRF) lead paint analyzer to sample paint for lead. XRF instrument serial #2737 was used on this job.

Licensed EPA Lead Risk Assessor Debra Koontz (License No. LBP-R-I191376-3) performed the inspection services.

If you have any questions or concerns regarding this report, please feel free to contact us at (407)614-4572.

Sincerely,

A handwritten signature in black ink that reads "Debra Koontz". The signature is written in a cursive style.

Debra Koontz, President

DK Environmental & Construction Services, Inc.

II. Executive Summary

DKE was authorized to perform a lead-based paint (LBP) inspection/risk assessment of the property located at **1010 SW 5th Street, Ocala, FL 34471**. DKE tested all painted components according to the specifications described in the protocols for Lead Based Paint testing in the Housing and Urban Development (HUD) Guidelines Chapter 7 (revised 1997) and all applicable Federal, State, and Local regulations.

DKE's scope of services involved XRF testing as well as a surface-by-surface visual inspection of all painted surfaces throughout the entire property to determine which lead-based paint surfaces/components are deteriorated (above de minimis level). All accessible, painted building components (that potentially contain lead-based paint) were tested utilizing X-Ray Fluorescence (XRF) Analysis. The data collected is in Appendix V. Wall "A" in each room is the wall where the front entrance door opening is located (or aligned with the street). Going clockwise and facing wall "A", wall "B" will always be to your right, Wall "C" directly to the rear and wall "D" to the left.

DKE tested a total of **one hundred and eight (108) surfaces via XRF analysis and six (6) calibrations. Ten (10) were found to contain lead at levels greater than or equal to the regulatory level of 1.0 mg/cm²**. These surfaces are identified in Section III: G. This report represents all field data, observations and findings related to the lead inspection performed in the above referenced property. The results, assessments and findings stated in this report are representative of the conditions observed in this property at the time of the inspection services. The detached exterior shed was not tested at the request of the client.

This inspection measures lead in both deteriorated and intact paint surfaces. The procedure involved taking readings from representative surfaces throughout the testing area or room. The most common primary analytical method for detecting lead in paint is X-Ray Fluorescence (XRF). The XRF instrument is used because of its demonstrated abilities to accurately determine the amount of lead that is present without disturbing the painted surfaces as well as its high speed and relatively low cost per sample.

Some building components may have been inaccessible at the time of the inspection services, or were not tested because they were covered by other building materials (paneling, tile, siding, etc.). It is possible that painted surfaces may be hidden by these materials. Such surfaces should be assumed to contain lead-based paint, or should be tested by a licensed lead-based paint inspector or risk assessor.

III. Scope of Inspection

A. Building Background

The property located at **1010 SW 5th Street, Ocala, FL 34471** is an approximately **1,798** square feet building (1 unit), built in **1958**. No history of renovations, repairs, or painting was provided to DKE during the inspection services.

B. Preface

DKE was authorized to perform lead-based paint testing of the above referenced property to determine the possible presence, condition, location and amount of lead-based paint. The testing was conducted on **August 13, 2024** from 11:17am to 12:09pm.

C. Training

All inspectors utilized by DKE have EPA/State licensure and are licensed Lead Risk Assessors who have passed the "HUD Visual Assessment Course". All Lead Risk Assessors utilized by DKE have also been trained in the use, calibration and maintenance of the X-Ray Fluorescence (XRF) equipment they currently use, along with necessary principles of Radiation Safety.

D. Equipment

An RMD LPA-1 X-Ray Fluorescence (XRF) lead paint analyzer, serial #2737 was used on this job.

E. Inspection Company

The inspection services were performed by an inspector/risk assessor employed by DK Environmental & Construction Services, Inc., 8786 Sonoma Coast Drive, Winter Garden, FL 34787, telephone number (407)614-4572.

F. Methods

The calibration of the type of X-Ray Fluorescence (XRF) is done in accordance with the Performance Characteristic Sheet (PCS) for this instrument. These XRF instruments are calibrated using a calibration standard block of known lead content. Three calibration readings are taken before and after each property is tested to insure manufacturer's standards are met. If the inspection is longer than four hours, a set of three calibration readings must be taken before the four hours expires, and then an additional three calibration readings taken at the end of the inspection. If for any reason the instrument is not maintaining a consistent calibration reading within the manufacturer's standards for performance on the calibration block supplied by the manufacturer, manufacturer's recommendations are used to bring the instrument into calibration. If the instrument cannot be brought back into calibration, it is taken off the site and sent back to the manufacturer for repair and/or re-calibration.

G. Findings

Property Address: **1010 SW 5th Street, Ocala, FL 34471**

DKE tested a total of **one hundred and eight (108) surfaces via XRF analysis and six (6) calibrations. Ten (10) were found to contain lead at levels greater than or equal to the regulatory level of 1.0 mg/cm² in paint in the surfaces tested:**

Exterior Components

Read No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Paint Color	Lead (mg/cm ²)	Mode
001 Exterior									
008	A	Clng Beam	Rgt		D	Wood	Red	1.6	QM
014	A	Fascia	Rgt		D	Wood	Red	1.5	QM
004	A	Soffit	Lft		D	Wood	Red	1.5	QM
013	A	Soffit	Rgt		D	Wood	Red	2.2	QM
009	A	Door	Rgt	Casing	D	Wood	Red	1.4	QM
015	B	Post	Rgt		D	Metal	Red	1.8	QM
027	B	Soffit	Rgt		D	Wood	Red	1.6	QM
022	B	Door	Rgt	Jamb	D	Wood	Red	1.0	QM
041	D	Fascia	Rgt		D	Wood	Red	2.4	QM
040	D	Soffit	Rgt		D	Wood	Red	1.5	QM

H. Conclusions

The above-listed components were determined to be positive for lead-based paint, as defined by Environmental Protection Agency/Department of Housing and Urban Development (EPA/HUD) as containing lead-in concentrations greater than or equal to 1.0 mg/cm².

When evaluating this report, according to Chapter 7 HUD guidelines it is assumed that if one testing combination (i.e. window, door) is lead-positive in an interior or exterior room equivalent, all other similar testing combinations in those areas are assumed to be lead-positive. The same is true for negative readings. All inaccessible areas are assumed to be lead-positive, even though they were not able to be tested. Inaccessible areas are noted in Section V – XRF Results.

If the lead evaluation results indicate the presence of lead-based paint, the prospective owner may wish to obtain, at *the prospective owner's expense*, additional services of a lead-based paint inspector or risk assessor, certified for the State in which the property is located, to help understand the positive results. This person would review this report and might make additional recommendations about lead hazard control actions. Interpretations and possible actions may vary when only a few readings indicate the presence of lead-based paint.

This inspection was done in accordance with Lead Safe Housing Rule 24 CFR Part 35 subpart J as amended June 21, 2004. The sample results are presented in Appendix V.

The surface conditions ranged from “Intact” to “Deteriorated” at the time of the inspection. Upon completion of lead hazard reduction activities, A clearance examination is required to determine that the lead hazard reduction efforts were performed adequately. “Paint Film Stabilization” means to repair any defect in the substrate, or any defect in a building component, that is causing the paint deterioration, to remove all loose paint and other loose material from the surface to be treated using lead-safe work practices, and to apply a new protective coating of paint.

A Clearance Examination would include a visual evaluation of all surfaces that were determined to be defective during the initial inspection, and collection of dust samples. It should be determined that the deteriorated paint surfaces have been corrected and that no settled dust lead hazards exist in the dwelling or unit. The clearance report must be signed by a certified/licensed Lead Inspector/Risk Assessor.

Painted surfaces found to be intact during the inspection which contain levels of lead greater than or equal to 1.0 mg/cm² could create lead hazards if the paint is turned into dust by abrasion, scraping, or sanding. If conditions of intact paint surfaces become destabilized, these conditions will need to be addressed. If any future construction or modernization work is done on the premises, this report should be given to the contractors as well as the tenants.

I. Lead Dust/Soil Hazards

The Following is a List of Lead-Dust Hazards Identified During the Risk Assessment:

- No dust wipes were taken at the request of the client

The Following is a List of Lead-In-Soil Hazards Identified During the Risk Assessment:

- No lead-in-soil hazards were identified during the risk assessment

J. Recommendations and Options

Property Address: **1010 SW 5th Street, Ocala, FL 34471**

The following LBP recommendations are based on U.S. Department of Housing and Urban Development (HUD) guidelines for the Evaluation and Control of LBP Hazards in Housing with the 1997 revisions, and all State and Local regulations.

According to Chapter 7 HUD guidelines, if one testing combination (i.e. window, door) is positive for lead in an interior or exterior room equivalent, then all other similar testing combinations in those areas are also assumed to be positive for lead. Likewise, the same is true for negative readings.

Some building components may have been inaccessible at the time of the inspection services, or were not tested because they were covered by other building materials (paneling, tile, siding, etc.). It is possible that painted surfaces may be hidden by these materials. Such surfaces should be assumed to contain lead-based paint, or should be tested by a licensed lead-based paint inspector or risk assessor.

RECOMMENDATIONS

DKE recommends that corrective action is taken for the following components which were found to contain lead at levels greater than or equal to the regulatory level of 1.0 mg/cm² and to be in "Deteriorated" condition. Any and all lead abatement activities should be performed by a licensed and insured Lead Abatement Contractor. It is the Lead Abatement Contractor's responsibility to follow all city, state and federal guidelines when performing lead abatement activities. It is also the Lead Abatement Contractor's responsibility to confirm all quantities and conditions:

Exterior Components

Read					Paint		Paint	Lead	
No.	Wall	Structure	Location	Member	Cond	Substrate	Color	(mg/cm ²)	Mode
001 Exterior									
008	A	Clnng Beam	Rgt		D	Wood	Red	1.6	QM
014	A	Fascia	Rgt		D	Wood	Red	1.5	QM
004	A	Soffit	Lft		D	Wood	Red	1.5	QM
013	A	Soffit	Rgt		D	Wood	Red	2.2	QM
009	A	Door	Rgt	Casing	D	Wood	Red	1.4	QM
015	B	Post	Rgt		D	Metal	Red	1.8	QM
027	B	Soffit	Rgt		D	Wood	Red	1.6	QM
022	B	Door	Rgt	Jamb	D	Wood	Red	1.0	QM
041	D	Fascia	Rgt		D	Wood	Red	2.4	QM
040	D	Soffit	Rgt		D	Wood	Red	1.5	QM

OPTIONS

The options offered herein are based upon observations and XRF results taken during the lead-based paint inspection/risk assessment. Estimated pricing for these options are not provided due to construction industry fluctuations. Precise estimates should be obtained from a certified lead-based paint contractor.

ACCEPTABLE LEAD-BASED PAINT OPTIONS

("IC" = Interim Controls "LSWP" = Lead-Safe Work Practices)

Exterior Door Components

Read No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Paint Color	Lead (mg/cm ²)	Mode
001 Exterior									
009	A	Door	Rgt	Casing	D	Wood	Red	1.4	QM
022	B	Door	Rgt	Jamb	D	Wood	Red	1.0	QM

- Option A. Friction control and paint film stabilization of lead-positive door components by application of 1 coat of Kilz primer or equivalent over a LSWP prepared surface and 2 top coats of exterior exposure residential paint following manufacturer’s recommendations. Color chosen by owner. (IC)
- Option B. Remove lead-positive components and install a new steel insulated door including new jambs, casing, and threshold using LSWP.
- Option C. Remove lead-based paint chemically and repaint using LSWP.

Exterior Porch Ceiling Beam

Read No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Paint Color	Lead (mg/cm ²)	Mode
001 Exterior									
008	A	Clng Beam	Rgt		D	Wood	Red	1.6	QM

- Option A. Paint film stabilization of all lead positive components by application of 1 coat of Kilz primer or equivalent over a LSWP prepared surface and 2 top coats of exterior exposure residential paint following manufacturer’s recommendations. Color chosen by owner. (IC)
- Option B. Enclosure of all lead-positive components with metal coil stock using LSWP.
- Option C. Encapsulation of lead-positive components by application of LBC (Lead Barrier Compound) over a LSWP prepared surface.
- Option D. Removal of lead-positive components and replacement with material similar in appearance, composition and finish using LSWP.
- Option E. Remove lead-based paint chemically and repaint using LSWP.

Exterior Soffit and Fascia

Read No.	Wall	Structure	Location	Member	Paint		Paint Color	Lead (mg/cm ²)	Mode
					Cond	Substrate			
001 Exterior									
014	A	Fascia	Rgt		D	Wood	Red	1.5	QM
004	A	Soffit	Lft		D	Wood	Red	1.5	QM
013	A	Soffit	Rgt		D	Wood	Red	2.2	QM
027	B	Soffit	Rgt		D	Wood	Red	1.6	QM
041	D	Fascia	Rgt		D	Wood	Red	2.4	QM
040	D	Soffit	Rgt		D	Wood	Red	1.5	QM

- Option A. Paint film stabilization by application of 1 coat of Kilz primer or equivalent over a LSWP prepared surface and 2 top coats of exterior exposure residential paint following manufacturer's recommendations. Color chosen by owner. (IC)
- Option B. Enclosure of all lead-positive components with vinyl soffit/metal coil stock using LSWP.
- Option C. Encapsulation of lead-positive components by application of LBC (Lead Barrier Compound) using LSWP.
- Option D. Removal of lead-positive components and replacement with material similar in appearance, composition, and finish using LSWP.
- Option E. Remove lead-based paint chemically and repaint using LSWP.

Exterior Post

Read No.	Wall	Structure	Location	Member	Paint		Paint Color	Lead (mg/cm ²)	Mode
					Cond	Substrate			
001 Exterior									
015	B	Post	Rgt		D	Metal	Red	1.8	QM

- Option A. Paint film stabilization of all lead-positive components by application of 1 coat of Kilz primer or equivalent over a LSWP prepared surface and 2 top coats of exterior exposure residential paint following manufacturer's recommendations. Color chosen by owner. (IC)
- Option B. Enclosure of all lead-positive components with metal coil stock using LSWP.
- Option C. Encapsulation of lead-positive components by application of LBC (Lead Barrier Compound) over a LSWP prepared surface.
- Option D. Removal of lead-positive components and replacement with material similar in appearance, composition and finish using LSWP.
- Option E. Remove lead-based paint chemically and repaint using LSWP.

Dust Mitigation and Cleaning of Work Areas

Option A. Specialized lead dust cleaning of all window troughs, window sills, and floors in all work areas in preparation for clearance. This includes areas where lead-based paint was identified, as well as general renovation areas.

IV. DISCLOSURE RESPONSIBILITY AND DISCLAIMER**Disclosure Responsibility**

A copy of this report must be provided to new lessees (tenants) and purchasers of this property under Federal Law (24 CFR part 35 and 40 CFR part 745) before they become obligated under a lease or sales contract. The complete report must also be provided to new purchasers and it must be made available to new tenants. Landlords (lessors) and sellers are also required to distribute an educational pamphlet and include standard warning language in their leases or sales contracts to ensure that parents have the information they need to protect their children from lead-based paint hazards.

Disclaimer

This is our report of a visual survey, and X-Ray Fluorescence (XRF) analysis of the readily accessible areas of this building and tested components. The presence or absence of lead-based paint or lead-based paint hazards applies only to the tested or assessed surfaces on the date of the field visit. It should be understood that conditions noted within this report were accurate at the time of the inspection services and in no way reflect the conditions at the property after the date of the inspection services. No other environmental concerns were addressed during the inspection services.

V. XRF Results

1010 SW 5th Street, Ocala, FL 34471

Read No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Paint Color	Lead (mg/cm ²)	Mode
001 Exterior									
005	A	Fascia	Lft		D	Wood	Red	0.7	QM
008	A	Clng Beam	Rgt		D	Wood	Red	1.6	QM
011	A	Porch Ceilin	Rgt		D	Wood	Stain	0.2	QM
012	A	Post	Rgt		D	Metal	Red	0.6	QM
014	A	Fascia	Rgt		D	Wood	Red	1.5	QM
006	A	Wall	U Lft		I	Block	White	-0.6	QM
004	A	Soffit	Lft		D	Wood	Red	1.5	QM
013	A	Soffit	Rgt		D	Wood	Red	2.2	QM
007	A	Window	Ctr	Shutter	D	Wood	Red	0.2	QM
009	A	Door	Rgt	Casing	D	Wood	Red	1.4	QM
010	A	Door	Rgt	Door	D	Wood	White	0.5	QM
025	B	Shelf	Ctr		D	Wood	White	0.1	QM
015	B	Post	Rgt		D	Metal	Red	1.8	QM
016	B	Driveway	Rgt		D	Concrete	Gray	-0.1	QM
018	B	Shelf	Rgt		D	Wood	White	0.1	QM
026	B	Post	Rgt		D	Metal	White	0.1	QM
028	B	Fascia	Rgt		D	Wood	Red	-0.4	QM
017	B	Wall	U Rgt		I	Block	White	0.1	QM
019	B	Ceiling	Rgt		D	Wood	Stain	0.5	QM
027	B	Soffit	Rgt		D	Wood	Red	1.6	QM
032	B	Window	Lft	Casing	D	Wood	White	0.7	QM
023	B	Door	Ctr	Jamb	I	Wood	Red	-0.4	QM
021	B	Door	Rgt	Door	D	Wood	Red	0.6	QM
022	B	Door	Rgt	Jamb	D	Wood	Red	1.0	QM
020	B	Stairs	Rgt	Risers	D	Wood	Stain	-0.3	QM
034	C	Fascia	Rgt		D	Wood	Red	-0.3	QM
031	C	Wall	U Rgt		I	Block	White	-0.4	QM
033	C	Soffit	Rgt		D	Wood	Red	0.4	QM
024	C	Door	Rgt	Door	D	Wood	Red	-0.2	QM
029	C	Door	Rgt	Door	D	Wood	Red	0.4	QM
030	C	Door	Rgt	Casing	D	Wood	Red	0.3	QM
041	D	Fascia	Rgt		D	Wood	Red	2.4	QM
035	D	Wall	L Rgt		D	Block	White	0.0	QM
040	D	Soffit	Rgt		D	Wood	Red	1.5	QM
042	D	Window	Rgt	Casing	I	Wood	White	0.2	QM
036	D	Window	Rgt	Sill	I	Concrete	White	0.1	QM
037	D	Door	Rgt	Casing	I	Wood	White	0.1	QM
038	D	Door	Rgt	Jamb	I	Wood	Red	0.1	QM
039	D	Door	Rgt	Door	I	Wood	Red	-0.1	QM
Interior Room 002 Kitchen									
051	A	Wall	U Ctr		I	Plaster	White	-0.1	QM
043	A	Baseboard	Ctr		I	Wood	Stain	-0.1	QM
044	A	Door	Rgt	Jamb	D	Wood	Stain	0.4	QM
052	B	Wall	U Lft		I	Plaster	White	-0.1	QM
045	B	Door	Ctr	Door	I	Wood	Stain	0.0	QM
047	C	Cabinet	Ctr		I	Wood	Stain	-0.2	QM
049	C	Wall	U Rgt		I	Plaster	White	0.1	QM
048	C	Ceiling	Rgt		D	Plaster	White	-0.2	QM
046	C	Window	Lft	Casing	I	Wood	Stain	-0.2	QM
050	D	Wall	U Ctr		I	Plaster	White	0.1	QM
Interior Room 003 TV Room									
053	A	Wall	U Ctr		I	Wood	Stain	-0.1	QM
054	A	Ceiling	Ctr		I	Plaster	White	0.0	QM
055	B	Window	Ctr	Sill	I	Wood	Stain	-0.1	QM
056	D	Door	Rgt	Door	I	Wood	Stain	0.1	QM
057	D	Door	Rgt	Casing	I	Wood	Stain	0.2	QM

Read No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Paint Color	Lead (mg/cm ²)	Mode
Interior Room 004 Living Rm									
063	A	Wall	U Ctr		I	Plaster	Yellow	0.3	QM
060	A	Baseboard	Ctr		I	Wood	Stain	-0.1	QM
061	A	Floor	Ctr		I	Wood	Stain	0.1	QM
062	A	Ceiling	Ctr		I	Plaster	Yellow	-0.3	QM
058	A	Door	Lft	Casing	I	Wood	Stain	0.0	QM
059	A	Door	Lft	Door	I	Wood	Stain	0.2	QM
064	B	Wall	U Ctr		I	Plaster	Yellow	0.1	QM
065	C	Wall	U Ctr		I	Plaster	Yellow	-0.1	QM
066	D	Wall	U Rgt		I	Plaster	Yellow	-0.3	QM
Interior Room 005 Hallway									
068	A	Wall	U Rgt		I	Plaster	Yellow	-0.2	QM
072	B	Closet wall	Lft		I	Plaster	Tan	-0.1	QM
069	B	Wall	U Ctr		I	Plaster	Yellow	0.3	QM
073	C	Closet wall	Rgt		I	Plaster	Gray	0.0	QM
070	C	Wall	U Lft		I	Plaster	Yellow	0.2	QM
071	C	Ceiling	Lft		I	Plaster	Yellow	0.0	QM
074	C	Door	Rgt	Door	I	Wood	Stain	-0.1	QM
075	C	Door	Rgt	Jamb	I	Wood	Stain	0.1	QM
067	D	Wall	U Lft		I	Plaster	Yellow	0.2	QM
Interior Room 006 Bathroom									
080	A	Wall	U Ctr		I	Plaster	Yellow	0.1	QM
081	B	Wall	U Ctr		I	Plaster	Yellow	-0.2	QM
078	C	Wall	U Lft		D	Plaster	Yellow	0.1	QM
077	C	Ceiling	Lft		D	Plaster	Yellow	-0.1	QM
076	C	Door	Rgt	Casing	I	Wood	Stain	0.2	QM
079	D	Wall	U Ctr		D	Plaster	Yellow	-0.2	QM
Interior Room 007 Bedroom A									
088	A	Wall	U Lft		I	Plaster	Yellow	0.1	QM
085	B	Wall	U Ctr		I	Plaster	Yellow	0.3	QM
082	B	Baseboard	Ctr		I	Wood	Stain	0.2	QM
084	B	Ceiling	Ctr		I	Plaster	Yellow	0.0	QM
083	B	Door	Rgt	Jamb	I	Wood	Stain	0.1	QM
086	C	Wall	U Ctr		I	Plaster	Yellow	0.0	QM
087	D	Wall	U Lft		I	Plaster	Yellow	0.0	QM
Interior Room 008 Bedroom B									
089	A	Wall	U Ctr		I	Plaster	Yellow	0.1	QM
094	B	Closet wall	Rgt		I	Plaster	Tan	0.0	QM
095	B	Closet Shelf	Rgt		I	Wood	Stain	0.3	QM
090	B	Wall	U Lft		I	Plaster	Yellow	-0.2	QM
093	B	Ceiling	Rgt		I	Plaster	Yellow	0.0	QM
096	B	Door	Rgt	Door	I	Wood	Stain	-0.1	QM
097	B	Door	Rgt	Casing	I	Wood	Stain	-0.1	QM
091	C	Wall	U Ctr		I	Plaster	Yellow	-0.3	QM
092	D	Wall	U Rgt		I	Plaster	Yellow	-0.1	QM
Interior Room 009 Bathroom									
100	A	Wall	U Rgt		D	Plaster	White	-0.1	QM
099	A	Ceiling	Rgt		D	Plaster	White	0.0	QM
098	A	Door	Rgt	Door	D	Wood	Stain	-0.1	QM
101	B	Wall	U Ctr		D	Plaster	White	0.4	QM
102	C	Wall	U Ctr		D	Plaster	White	0.2	QM
103	D	Wall	U Ctr		I	Plaster	White	0.3	QM

Read No.	Wall	Structure	Location	Member	Paint Cond	Substrate	Paint Color	Lead (mg/cm ²)	Mode
Interior Room 010 Bedroom C									
109	A	Wall	U Ctr		I	Plaster	Yellow	0.4	QM
110	B	Wall	U Ctr		I	Plaster	Yellow	0.0	QM
111	C	Wall	U Lft		I	Plaster	Yellow	0.0	QM
106	D	Closet wall	Lft		D	Plaster	Tan	-0.1	QM
108	D	Wall	U Ctr		I	Plaster	Yellow	0.2	QM
104	D	Floor	Lft	Door	D	Wood	Stain	0.3	QM
105	D	Floor	Lft	Jamb	I	Wood	Stain	0.0	QM
107	D	Ceiling	Lft		I	Plaster	Yellow	-0.1	QM
Calibration Readings									
001								1.0	TC
002								1.0	TC
003								0.9	TC
112								0.9	TC
113								1.0	TC
114								0.9	TC


---- End of Readings ----

VI. Drawings/Floor Plans



DK Environmental & Construction Services, Inc.
8786 Sonoma Coast Drive, Winter Garden, FL 34787
407-614-4572 814-243-1927
dkenvironmental@yahoo.com

SITE PLAN

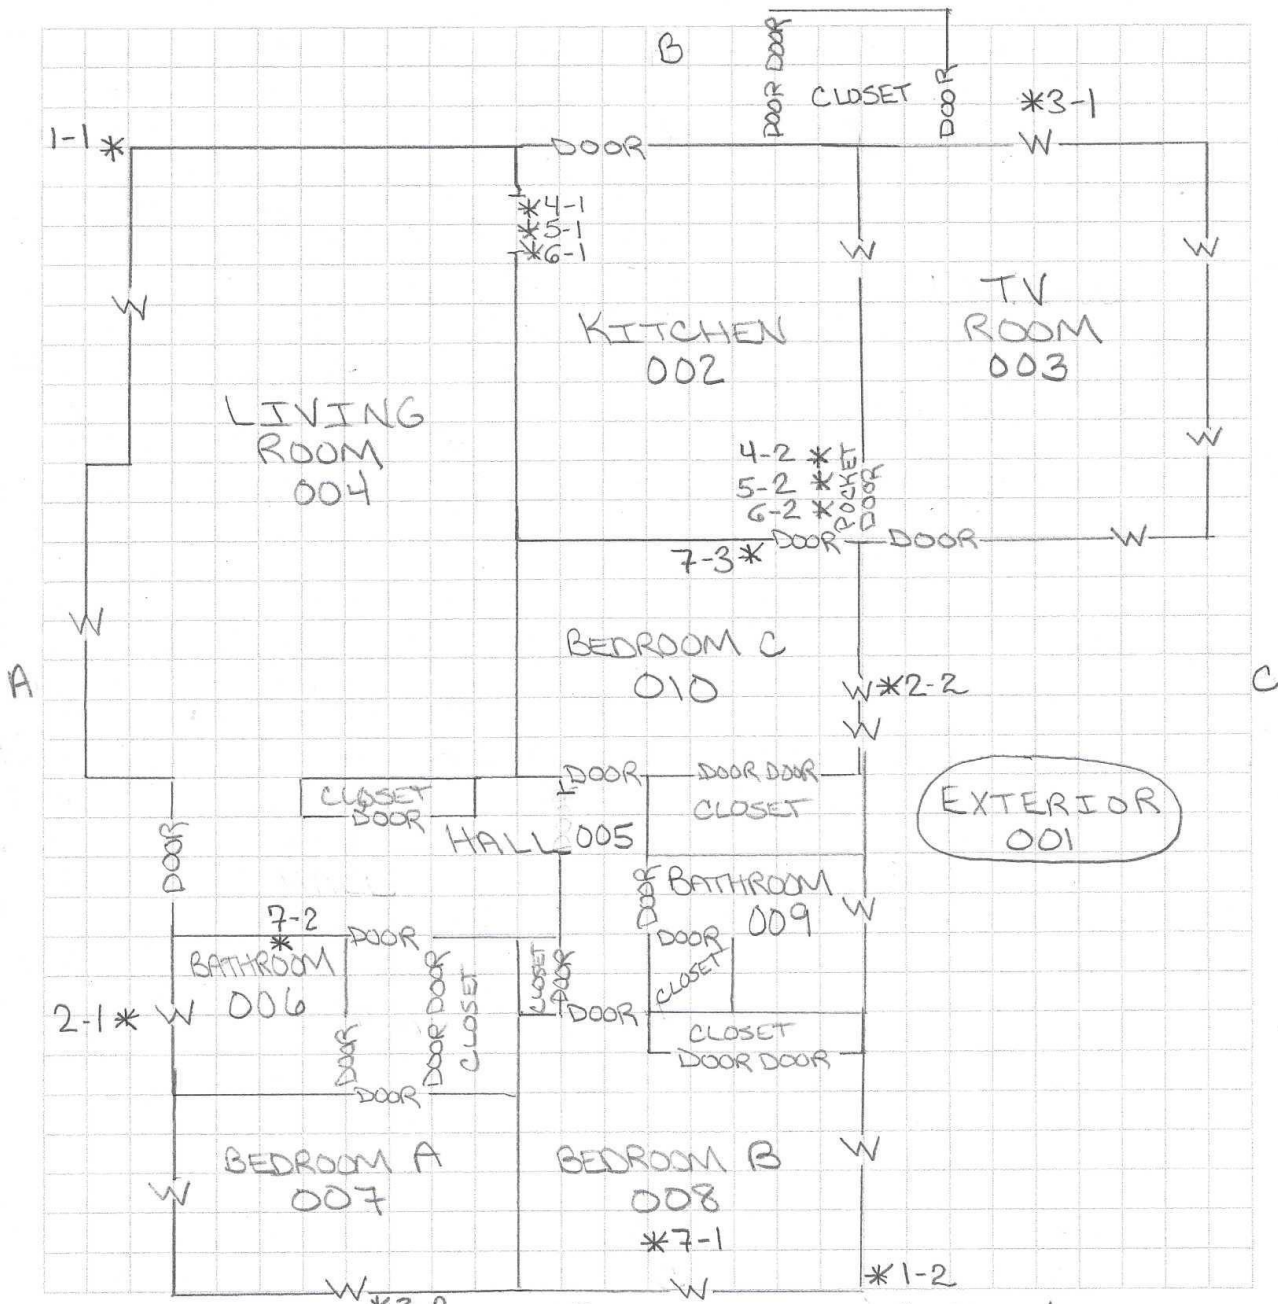

Case # 08131117

Address 1010 SW 5th Street
Ocala, FL 34471

Lead and Asbestos

VII. Property Photographs

1010 SW 5th Street, Ocala, FL 34471



Exterior(001) A-Wall



Exterior(001) B-Wall



Exterior(001) C-Wall



Exterior(001) D-Wall



Exterior(001) A-Wall
Wood Soffit, Fascia
Lead-Positive, Deteriorated
(Typical Exterior)



Exterior(001) B-Wall
Wood Soffit
Lead-Positive, Deteriorated
(Typical Exterior)



Exterior(001) B-Wall, Right
Metal Post
Lead-Positive, Deteriorated



Exterior(001) B-Wall, Right
Wood Door Jamb
Lead-Positive, Deteriorated



Exterior(001) D-Wall
Wood Soffit, Fascia
Lead-Positive, Deteriorated
(Typical Exterior)

VIII. Risk Assessment Forms

DK ENVIRONMENTAL & CONSTRUCTION SERVICES, INC.

8786 Sonoma Coast Drive, Winter Garden, FL 34787
Office: 407-614-4572 Cell: 814-243-1927

dkenvironmental@yahoo.com
www.dk-environmental.com

RESIDENT QUESTIONNAIRE

Date of Construction 1958

Children/Children's Habits

1. (a) Do you have any children that live in your home? Yes No
(If no children, skip to Question 5)
- (b) If yes, how many? 4 Ages? 6, 4, 4, 1
- (c) Record blood lead levels, if known. _____

2. Location of the rooms/areas where each child sleeps, eats, and plays.

Name of child	Location of bedroom	Location of all rooms where child eats	Primary location where child plays indoors	Primary location where child plays outdoors
Reign James	Pear Bedrooms	Kitchen	Throughout	Yards
Royal James	↓	↓	↓	↓
Jahkhi Holman	↓	↓	↓	↓
Jacobi Beard	↓	↓	↓	↓

3. Where are toys stored/kept? _____
4. Is there any visible evidence of chewed or peeling paint on the woodwork, furniture, or toys?
Yes No

Family Use Patterns

5. Which entrances are used most frequently? Kitchen
6. Which windows are opened most frequently? Various
7. Do you use window air conditioners? If yes, where?
(Condensation often causes paint deterioration) None
8. (a) Do any household members garden? Yes No
(b) Location of garden _____
(c) Are you planning any landscaping activities that will remove grass or ground covering? Yes No
9. (a) How often is the household cleaned? When needed
(b) What cleaning methods do you use? General
10. (a) Did you recently complete any building renovations? Yes No
(b) If yes, where? _____
(c) Was building debris stored in the yard? If yes, where? _____
11. Are you planning any building renovations? If yes, where? Various
12. (a) Do any household members work in a lead-related industry? Yes No
(b) If yes, where are dirty work clothes placed and cleaned? _____

Sheryl Roberts
Homeowner Signature

08/13/24
Date

DK ENVIRONMENTAL & CONSTRUCTION SERVICES, INC.

8786 Sonoma Coast Drive, Winter Garden, FL 34787
Office: 407-614-4572 Cell: 814-243-1927

dkenvironmental@yahoo.com
www.dk-environmental.com

BUILDING CONDITION FORM

Property Address 1010 SW 5th Street, Ocala, FL 34471

Date of Risk Assessment 08/13/24

CONDITION	YES	NO
Roof missing parts of surfaces (tiles, boards, shakes, etc.)	✓	
Roof has holes or large cracks	✓	
Gutters or downspouts broken		✓
Chimney masonry cracked, bricks loose or missing, obviously out of plumb		✓
Exterior or interior walls have obvious large cracks or holes, requiring more than routine pointing (if masonry) or painting	✓	
Exterior siding has missing boards or shingles		✓
Water stains on interior walls or ceilings		✓
Plaster walls or ceilings deteriorated	✓	
Two or more windows or doors broken, missing, or boarded up		✓
Porch or steps have major elements broken, missing, or boarded up		✓
Foundation has major cracks, missing material, structure leans, or visibly unsound		✓
* TOTAL NUMBER	4	7

* If the "YES" column has two or more checks, the dwelling is usually considered to be in poor condition for the purposes of a risk assessment. However, specific conditions and extenuating circumstances should be considered before determining the final condition of the dwelling and the appropriateness of a lead hazard screen.

Notes: DETACHED EXTERIOR SHED NOT TESTED

Circle the Answer to each or write in different information:

- Housekeeping - Poor Fair Good
- Soffit/Fascia - Wrapped Bare
- Exterior Walls - Brick Aluminum Vinyl Wood Other CONCRETE BLOCK
- Type of Structure - Single Family Detached Duplex Apartment

DK ENVIRONMENTAL & CONSTRUCTION SERVICES, INC.

8786 Sonoma Coast Drive, Winter Garden, FL 34787
 Office: 407-614-4572 Cell: 814-243-1927

dkenvironmental@yahoo.com
 www.dk-environmental.com

XRF FIELD DATA

Billing Client: Ocala Community Development Date of Inspection/Assessment: 08/13/24
 Address: 201 SE 3rd St, 2nd Floor Resident's Name: Sheryl Roberts
Ocala, FL 34471 Inspection/Assessment Address: _____
 Contact/Phone Number: Ailin Abboud 1010 SW 5th Street
352-629-8231 Ocala, FL 34471

Inspector Name/License No: DEBRA KOONTE/LBP-R-I191376-2
 XRF Report No: 08131117 Number of Readings: 114
 XRF Serial Number: 2737 Number of Wipes Collected: 1 soil

<p><u>Purpose of Inspection/Assessment:</u></p> <p><input checked="" type="checkbox"/> Owner-Occupied Rehabilitation Program</p> <p><input type="checkbox"/> First Time Home Buyer Program</p> <p><input type="checkbox"/> Section 8 Qualification</p> <p><input type="checkbox"/> Real Estate Transaction</p> <p><input type="checkbox"/> Commercial/Industrial Compliance</p> <p><input type="checkbox"/> Personal/Private Request</p> <p><input type="checkbox"/> Clearance Only</p> <p><input type="checkbox"/> Renter Rehabilitation</p> <p><input type="checkbox"/> Landlord Renovation</p> <p><input type="checkbox"/> Other _____</p>	<p><u>Type of Construction:</u></p> <p><input type="checkbox"/> Wood Frame</p> <p><input type="checkbox"/> Brick</p> <p><input type="checkbox"/> Vinyl Siding</p> <p><input type="checkbox"/> Aluminum Siding</p> <p><input checked="" type="checkbox"/> Other: <u>CONCRETE BLOCK</u></p> <p>Number of Stories: <u>1</u></p> <p>Number of Rooms: <u>10</u></p> <p>Date of Construction: <u>1958</u></p> <p>Porches and Location: <u>A-WALK</u></p> <p>Yards and Location: <u>SURROUNDING</u></p> <p><input type="checkbox"/> Garage (<input type="checkbox"/> Attached <input type="checkbox"/> Detached)</p>
---	---

Project Notes: _____

IX. License/Certification

United States Environmental Protection Agency

This is to certify that



Debra L. Koontz

has fulfilled the requirements of the Toxic Substances Control Act (TSCA) Section 402, and has received certification to conduct lead-based paint activities pursuant to 40 CFR Part 745.226 as:

Inspector

In the Jurisdiction of:

All EPA Administered Lead-based Paint Activities Program States, Tribes and Territories

This certification is valid from the date of issuance and expires May 13, 2027

LBP-I-1191376-2

Certification #

January 24, 2024

Issued On



Adrienne Priselac, Manager, Toxics Office

Land Division

United States Environmental Protection Agency

This is to certify that



Debra L. Koontz

has fulfilled the requirements of the Toxic Substances Control Act (TSCA) Section 402, and has received certification to conduct lead-based paint activities pursuant to 40 CFR Part 745.226 as:

Risk Assessor

In the Jurisdiction of:

All EPA Administered Lead-based Paint Activities Program States, Tribes and Territories

This certification is valid from the date of issuance and expires September 06, 2027

LBP-R-1191376-3

Certification #

August 05, 2024

Issued On



Adrienne Priselac, Deputy Director

Land, Chemicals & Redevelopment Division

X. XRF Performance Characteristics Sheet

Performance Characteristic Sheet

EFFECTIVE DATE: October 24, 2000

EDITION NO.: 4

MANUFACTURER AND MODEL:

Make: *Radiation Monitoring Devices*

Model: *LPA-1*

Source: *⁵⁷Co*

Note: This sheet supersedes all previous sheets for the XRF instrument of the make, model, and source shown above for instruments sold or serviced after June 26, 1995. For other instruments, see prior editions.

FIELD OPERATION GUIDANCE

OPERATING PARAMETERS

Quick mode or nominal 30-second standard mode readings.

XRF CALIBRATION CHECK LIMITS

0.7 to 1.3 mg/cm ² (inclusive)

SUBSTRATE CORRECTION:

For XRF results below 4.0 mg/cm², substrate correction is recommended for:

Metal using 30-second standard mode readings.

None using quick mode readings.

Substrate correction is not needed for:

Brick, Concrete, Drywall, Plaster, and Wood using 30-second standard mode readings

Brick, Concrete, Drywall, Metal, Plaster, and Wood using quick mode readings

THRESHOLDS:

30-SECOND STANDARD MODE READING DESCRIPTION	SUBSTRATE	THRESHOLD (mg/cm ²)
Results corrected for substrate bias on metal substrate only	Brick	1.0
	Concrete	1.0
	Drywall	1.0
	Metal	0.9
	Plaster	1.0
	Wood	1.0

QUICK MODE READING DESCRIPTION	SUBSTRATE	THRESHOLD (mg/cm ²)
Readings not corrected for substrate bias on any substrate	Brick	1.0
	Concrete	1.0
	Drywall	1.0
	Metal	1.0
	Plaster	1.0
	Wood	1.0

BACKGROUND INFORMATION

EVALUATION DATA SOURCE AND DATE:

This sheet is supplemental information to be used in conjunction with Chapter 7 of the HUD *Guidelines for the Evaluation and Control of Lead-Based Paint Hazards in Housing* (HUD Guidelines"). Performance parameters shown on this sheet are calculated from the EPA/HUD evaluation using archived building components. Testing was conducted on approximately 150 test locations in July 1995. The instrument that performed testing in September had a new source installed in June 1995 with 12 mCi initial strength.

OPERATING PARAMETERS:

Performance parameters shown in this sheet are applicable only when properly operating the instrument using the manufacturer's instructions and procedures described in Chapter 7 of the HUD Guidelines.

XRF CALIBRATION CHECK:

The calibration of the XRF instrument should be checked using the paint film nearest 1.0 mg/cm² in the NIST Standard Reference Material (SRM) used (e.g., for NIST SRM 2579, use the 1.02 mg/cm² film).

If readings are outside the acceptable calibration check range, follow the manufacturer's instructions to bring the instruments into control before XRF testing proceeds.

SUBSTRATE CORRECTION VALUE COMPUTATION

Chapter 7 of the HUD Guidelines provides guidance on correcting XRF results for substrate bias. Supplemental guidance for using the paint film nearest 1.0 mg/cm² for substrate correction is provided:

XRF results are corrected for substrate bias by subtracting from each XRF result a correction value determined separately in each house for single-family housing or in each development for multifamily housing, for each substrate. The correction value is an average of XRF readings taken over the NIST SRM paint film nearest to 1.0 mg/cm² at test locations that have been scraped bare of their paint covering. Compute the correction values as follows:

Using the same XRF instrument, take three readings on a bare substrate area covered with the NIST SRM paint film nearest 1 mg/cm². Repeat this procedure by taking three more readings on a second bare substrate area of the same substrate covered with the NIST SRM.

Compute the correction value for each substrate type where XRF readings indicate substrate correction is needed by computing the average of all six readings as shown below.

For each substrate type (the 1.02 mg/cm² NIST SRM is shown in this example; use the actual lead loading of the NIST SRM used for substrate correction):

$$\text{Correction value} = (1\text{st} + 2\text{nd} + 3\text{rd} + 4\text{th} + 5\text{th} + 6\text{th Reading}) / 6 - 1.02 \text{ mg/cm}^2$$

Repeat this procedure for each substrate requiring substrate correction in the house or housing development.

EVALUATING THE QUALITY OF XRF TESTING:

Randomly select ten testing combinations for retesting from each house or from two randomly selected units in multifamily housing. Use either 15-second readings or 60-second readings.

RMD LPA-1, PCS Edition 4, Page3 of 4

Conduct XRF re-testing at the ten testing combinations selected for retesting.

Determine if the XRF testing in the units or house passed or failed the test by applying the steps below.

Compute the Retest Tolerance Limit by the following steps:

Determine XRF results for the original and retest XRF readings. Do not correct the original or retest results for substrate bias. In single-family housing a result is defined as the average of three readings. In multifamily housing, a result is a single reading. Therefore, there will be ten original and ten retest XRF results for each house or for the two selected units.

Calculate the average of the original XRF result and retest XRF result for each testing combination.

Square the average for each testing combination.

Add the ten squared averages together. Call this quantity C.

Multiply the number C by 0.0072. Call this quantity D.

Add the number 0.032 to D. Call this quantity E.

Take the square root of E. Call this quantity F.

Multiply F by 1.645. The result is the Retest Tolerance Limit.

Compute the average of all ten original XRF results.

Compute the average of all ten re-test XRF results.

Find the absolute difference of the two averages.

If the difference is less than the Retest Tolerance Limit, the inspection has passed the retest. If the difference of the overall averages equals or exceeds the Retest Tolerance Limit, this procedure should be repeated with ten new testing combinations. If the difference of the overall averages is equal to or greater than the Retest Tolerance Limit a second time, then the inspection should be considered deficient.

Use of this procedure is estimated to produce a spurious result approximately 1% of the time. That is, results of this procedure will call for further examination when no examination is warranted in approximately 1 out of 100 dwelling units tested.

BIAS AND PRECISION:

Do not use these bias and precision data to correct for substrate bias. These bias and precision data were computed without substrate correction from samples with reported laboratory results less than 4.0 mg/cm² lead. The data which were used to determine the bias and precision estimates given in the table below have the following properties. During the July 1995 testing, there were 15 test locations with a laboratory-reported result equal to or greater than 4.0 mg/cm² lead. Of these, one 30-second standard mode reading was less than 1.0 mg/cm² and none of the quick mode readings were less than 1.0 mg/cm². The instrument that tested in July is representative of instruments sold or serviced after June 26, 1995. These data are for illustrative purposes only. Actual bias must be determined on the site. Results provided above already account for bias and precision. Bias and precision ranges are provided to show the variability found between machines of the same model.

30-SECOND STANDARD MODE READING MEASURED AT	SUBSTRATE	BIAS (mg/cm ²)	PRECISION [†] (mg/cm ²)
0.0 mg/cm ²	Brick	0.0	0.1
	Concrete	0.0	0.1
	Drywall	0.1	0.1
	Metal	0.3	0.1
	Plaster	0.1	0.1
	Wood	0.0	0.1
0.5 mg/cm ²	Brick	0.0	0.2
	Concrete	0.0	0.2
	Drywall	0.0	0.2
	Metal	0.2	0.2
	Plaster	0.0	0.2
	Wood	0.0	0.2
1.0 mg/cm ²	Brick	0.0	0.3
	Concrete	0.0	0.3
	Drywall	0.0	0.3
	Metal	0.2	0.3
	Plaster	0.0	0.3
	Wood	0.0	0.3
2.0 mg/cm ²	Brick	-0.1	0.4
	Concrete	-0.1	0.4
	Drywall	-0.1	0.4
	Metal	0.1	0.4
	Plaster	-0.1	0.4
	Wood	-0.1	0.4

[†]Precision at 1 standard deviation.

CLASSIFICATION RESULTS:

XRF results are classified as positive if they are greater than the upper boundary of the inconclusive range, and negative if they are less than the lower boundary of the inconclusive range, or inconclusive if in between. The inconclusive range includes both its upper and lower bounds. Earlier editions of this *XRF Performance Characteristics Sheet* did not include both bounds of the inconclusive range as "inconclusive." While this edition of the Performance Characteristics Sheet uses a different system, the specific XRF readings that are considered positive, negative, or inconclusive for a given XRF model and substrate remain unchanged, so previous inspection results are not affected.

DOCUMENTATION:

An EPA document titled *Methodology for XRF Performance Characteristic Sheet* provides an explanation of the statistical methodology used to construct the data in the sheets, and provides empirical results from using the recommended inconclusive ranges or thresholds for specific XRF instruments. For a copy of this document call the National Lead Information Center Clearinghouse at 1-800-424-LEAD. A HUD document titled *A Nonparametric Method for Estimating the 5th and 95th Percentile Curves of Variable-Time XRF Readings Based on Monotone Regression* provides supplemental information on the methodology for variable-time XRF instruments. A copy of this document can be obtained from the HUD lead web site, www.hud.gov/lea.

This edition of the XRF Performance Characteristic Sheet was developed by QuanTech, Inc., under a contract from the U.S. Department of Housing and Urban Development (HUD). HUD has determined that the information provided here is acceptable when used as guidance in conjunction with Chapter 7, Lead-Based Paint Inspection, of HUD's *Guidelines for the Evaluation and Control of Lead-Based Paint Hazards in Housing*.

XI. Glossary

Abatement: A measure or set of measures designed to permanently eliminate lead-based paint hazards or lead based paint. Abatement strategies include the removal of lead-based paint, enclosure, encapsulation, replacement of building components coated with lead-based paint, removal of lead-contaminated dust, and removal of lead-contaminated soil or overlaying of soil with a durable covering such as asphalt (grass and sod are considered interim control measures). All of these strategies require preparation, cleanup, waste disposal, post-abatement clearance testing, record keeping, and, if applicable, monitoring. See also **Complete Abatement** and **Interim controls**.

Accreditation: A formal recognition certifying that an organization, such as a laboratory, is competent to carry out specific tasks or types of tests.

Accuracy: The degree of agreement between an observed value and an accepted reference value (a "true" value); a data quality indicator. Accuracy includes a combination of random errors (Precision) and systematic errors (bias) due to sampling and analysis.

Bare soil: Soil not covered with grass, sod, some other similar vegetation, or paving, including the sand in sandboxes.

Building component: Any element of a building that may be painted or have dust on its surface, e.g. walls, stair treads, floors, railings, doors, windowsills, etc.

Certification: The process of testing and evaluating against certain specifications the competence of a person, organization, or other entity in performing a function or service, usually for a specified period of time.

Certified: The designation for Contractors who have completed training and other requirements to safely allow them to undertake risk assessments, inspections, or abatement work. Risk assessors, inspectors, and Abatement Contractors should be certified by the appropriate local, State, or Federal agency.

Chewable surface: See **Chewed surface**.

Chewed surface: Any painted surface that shows evidence of having been chewed or mouthed by a young child. A chewed surface is usually a protruding, horizontal part of a building, such as an interior windowsill.

Cleaning: The process of using a vacuum and wet cleaning agents to remove leaded dust. The process includes the removal of bulk debris from the work area. OSHA prohibits the use of compressed air to clean lead-contaminated dust from a surface.

Clearance examination: Visual examination and collection of environmental samples by an inspector or risk assessor, or, in some circumstances, a Sampling Technician, and analysis by an accredited laboratory upon completion of an abatement project, interim control intervention, or maintenance job that disturbs lead-based paint (or paint suspected of being lead-based). The clearance examination is performed to ensure that lead exposure levels do not exceed standards established by the EPA Administrator pursuant to Title IV of the Toxic Substances Control Act, and that any cleaning following such work adequately meets those standards.

Common area: A room or area that is accessible to all residents in a community (e.g. hallways or lobbies). In general, any area not kept locked.

Composite sample: A single sample made up of individual subsamples. Analysis of a composite sample produces the arithmetic mean of all subsamples.

Containment: A process to protect workers and the environment by controlling exposures to the lead-contaminated dust and debris created during abatement.

Deteriorated lead-based paint: Any lead-based paint coating on a damaged or deteriorated surface or fixture, or any interior or exterior lead-based paint that is peeling, chipping, flaking, worn, chalking, alligating, cracking, or otherwise becoming separated from the substrate.

Disposal (of waste): The discharge, deposit, injection, dumping, spilling, leaking, or placement of solid or liquid waste on land or in water so that none of its constituents can pollute the environment by being emitted into the air or discharged into a body of water, including groundwater.

Encapsulation: Any covering or coating that acts as a barrier between lead-based paint and the environment, the durability of which relies on adhesion and the integrity of the existing bonds between multiple layers of paint and between the paint and the substrate. See also **Enclosure**.

Enclosure: The use of rigid, durable construction materials that are mechanically fastened to the substrate to act as a barrier between the lead-based paint and the environment.

Evaluation: Risk assessment, paint inspection, reevaluation, investigation, clearance examination, or risk assessment screen.

Examination: See **Clearance Examination**.

Federal Register (FR): A daily Federal publication that contains proposed and final regulations, rules, and notices.

Impact Surface: An interior or exterior surface (such as surfaces on doors) subject to damage by repeated impact or contact.

Inspection (of paint): A surface-by-surface investigation to determine the presence of lead-based paint (in some cases including dust and soil sampling) and a report of the results.

Interim controls: A set of measures designed to temporarily reduce human exposure or possible exposure to lead-based paint hazards. Such measures include specialized cleaning, repairs, maintenance, painting, temporary containment, and management and resident education programs. Monitoring, conducted by Owners, and reevaluations, conducted by professionals, are integral elements of interim control. Interim controls include dust removal, paint film stabilization, treatment of friction and impact surfaces, installation of soil coverings such as grass or sod, and land use controls. See also **Monitoring, Reevaluations, and Abatement**.

Interior windowsill: The portion of the horizontal window ledge that protrudes into the interior of the room, adjacent to the window sash when the window is closed. Often called the window stool.

Latex: A waterborne emulsion paint made with synthetic binders, such as 100% acrylic, vinyl acrylic, terpolymer, or styrene acrylic. A stable emulsion of polymers and pigment in water.

Lead: Lead includes metallic lead and inorganic and organic compounds of lead.

Lead-based paint: Any paint, varnish, shellac, or other coating that contains lead equal to or greater than 1.0 mg/cm² (milligrams of lead per square centimeter of surface) as measured by XRF or laboratory analysis, or 0.5% by weight (5,000ug/g, 5,000 ppm (parts per million), or 5,000 mg/kg) as measured by laboratory analysis (Local definitions may vary.)

Lead-based paint hazard: A condition in which exposure to lead from lead-contaminated dust, lead-contaminated soil, or deteriorated lead-based paint would have an adverse effect on human health (as established by the EPA Administrator under Title IV of the Toxic Substances Control Act). Lead-based paint hazards include, for example, deteriorated lead-based paint, leaded dust levels above applicable standards. And bare leaded soil above applicable standards.

Lead-based paint hazards control: Activities to control and eliminate lead-based paint hazards, including interim controls, abatement, and complete abatement.

Lead-contaminated dust: Surface dust in residences that contains an area concentration of lead in excess of the standard established by the EPA Administrator, pursuant to Title IV of the Toxic Substances Control Act. As of April 01, 2017, EPA standards for lead dust for risk assessments are ≥ 10 ug/ft² (micrograms of lead per square foot) for floors, and ≥ 100 ug/ft² for interior windowsills. The EPA standard for clearance are < 10 ug/ft² for floors, 100 ug/ft² for windowsills, and 100 ug/ft² for window troughs. Porch floors are also wiped during final clearance, with a lead dust clearance action level of < 40 ug/ft².

Lead-contaminated soil: Bare soil on residential property that contains lead in excess of the standard established by the EPA Administrator, pursuant to Title IV of the Toxic Substances Control Act. The standard is 400 ug/g in play areas and 1,200 ug/g in the rest of the property.

Leaded dust: See **Lead-contaminated dust**.

Licensed: Holding a valid license or certification issued by the EPA or by an EPA-approved State program pursuant to Title IV of the Toxic Substances Control Act. The license is based on certification for lead-based paint hazard control work. See also **Certified**.

Maintenance: Work intended to maintain adequate living conditions in a dwelling, which has the potential to disturb lead-based paint or paint that is suspected of being lead-based.

Mean: The arithmetic average of a series of numerical data values. For example, the algebraic sum of the data values divided by the number of data values.

Microgram (ug): 1/1,000,000 of a gram. Used to measure weight.

Monitoring: Surveillance to determine (1) that known or suspected lead-based paint is not deteriorating, (2) that lead-based paint hazard controls, such as paint stabilization, enclosure, or encapsulation have not failed, and (3) that structural problems do not threaten the integrity of hazard controls.

Owner: A person, firm, corporation, guardian, conservator, receiver, trustee, executor, government agency or entity, or other judicial officer who, alone or with others, owns, holds, or controls the freehold or leasehold title or part of the title to property, with or without actually possessing it. This definition includes a vendee who possesses the title, but does not include a mortgagee or an Owner of a reversionary interest under a ground rent lease.

Paint inspector: An individual who has completed training from an accredited program and been licensed or certified by the appropriate State or local agency to (1) perform inspections to determine and report the presence of lead-based paint on a surface-by-surface basis through onsite testing, (2) report the findings of such an inspection, (3) collect environmental samples for laboratory analysis, (4) perform clearance testing, and optionally (5) document successful compliance with lead-based paint hazard control requirements or standards.

Paint removal: An abatement strategy that entails the removal of lead-based paint from surfaces. For lead hazard control work, this can mean using chemicals, heat guns below 1,100° F, and certain contained abrasive methods. Open-flame burning, open-abrasive blasting, sandblasting, extensive dry scraping, and stripping in a poorly ventilated space using a volatile stripper are prohibited paint removal methods. Hydroblasting is not recommended.

Plastic: See **Polyethylene plastic**.

Polyethylene plastic: All references to polyethylene plastic refer to 6 mil plastic sheeting or polyethylene bags (or double bags if using 4 mil polyethylene bags), or any other thick plastic material shown to demonstrate at least the equivalent dust contamination performance. Plastic used to contain waste should be capable of completely containing the waste and, after being properly sealed, should remain leak tight with no visible signs of discharge during movement or relocation.

Polyurethane: An exceptionally hard and wear-resistant coating (created by the reaction of polyols with a multifunctional isocyanate). Often used to seal wood floors following lead-based paint hazard control work and cleaning.

Reevaluation: In lead hazard control work, the combination of a visual assessment and collection of environmental samples performed by a certified risk assessor to determine if a previously implemented lead-based paint hazard control measure is still effective and if the dwelling remains lead-safe.

Removal: See **Paint removal**.

Renovation: Work that involves construction and/or home or building improvement measures such as window replacement, weatherization, remodeling, and repainting.

Replacement: A strategy of abatement that entails the removal of building components coated with lead-based paint (such as windows, doors, and trim) and the installation of new components free of lead-based paint.

Resident: A person who lives in a dwelling.

Risk assessment: An onsite investigation of a residential dwelling to discover any lead-based paint hazards. Risk assessments include an investigation of the age, history, management, and maintenance of the dwelling, and the number of children under age 6 and women of childbearing age who are residents; a visual assessment; limited environmental sampling (i.e. collection of dust wipe samples, soil samples, and deteriorated paint samples); and preparation of a report identifying acceptable abatement and interim control strategies based on specific conditions.

Risk assessor: A certified individual who has completed training with an accredited training program and who has been certified to (1) perform risk assessments, (2) identify acceptable abatement and interim control strategies for reducing identified lead-based paint hazards, (3) perform clearance testing and reevaluations, and (4) document the successful completion of lead-based paint hazard control activities.

Site: The land or body of water where a facility is located or an activity is conducted. The site includes adjacent land used in connection with the facility or activity.

Soil: See **Bare soil**.

Spectrum analyzer: A type of XRF analyzer that provides the operator with a plot of the energy and intensity, or counts of both K and L x-ray spectra, as well as a calculated lead concentration. See also **XRF analyzer**.

Standard deviation: A measure of the precision of a reading. The spread of the deviation from the mean. The smaller the standard deviation, the more precise the analysis. The standard deviation is calculated by first obtaining the mean, or the arithmetic average, of all of the readings. A formula is then used to calculate how much the individual values vary from the mean – the standard deviation is the square root of the arithmetic average of the squares of the deviation from the mean. Many hand calculators have an automatic standard deviation function. See also **Mean**.

Subsample: A representative portion of a sample. A subsample may be either a field sample or a laboratory sample. A subsample is often combined with other subsamples to produce a composite sample. See also **Composite sample**.

Substrate: A surface on which paint, varnish, or other coating has been applied or may be applied. Examples of substrates include wood, plaster, metal, and drywall.

Substrate effect: The radiation returned to an XRF analyzer by the paint, substrate, or underlying material, in addition to the radiation returned by any lead present. This radiation, when counted as lead x-rays by an XRF analyzer contributes to substrate equivalent lead (bias). The inspector may have to compensate for this effect when using XRF analyzers. See also **XRF analyzer**.

Substrate Equivalent Lead (SEL): The XRF measurement taken on an unpainted surface, used to calculate the corrected lead concentration on a surface by using the following formula: Apparent Lead Concentration-Substrate Equivalent Lead = Corrected Lead Concentration. See also **XRF analyzer**.

Target housing: Any residential unit constructed before 1978, except dwellings that do not contain bedrooms or dwellings that were developed specifically for the elderly or persons with disabilities, unless a child younger than 6 resides or is expected to reside in the dwelling. In the case of jurisdictions that banned the sale or use of lead-based paint before 1978, the Secretary of HUD may designate an earlier date for defining target housing.

Test location: A specific area on a testing combination where XRF instruments will test for lead-based paint.

Trained: Successful completion of a training course in a particular discipline. For lead hazards control work, the training course must be accredited by the EPA or by an EPA-approved State program, pursuant to Title IV of the Toxic Substances Control Act.

Treatment: In residential lead-based paint hazard control work, any method designed to control lead-based paint hazards. Treatment includes interim controls, abatement, and removal.

Trough: See **Window trough**.

Windowsill: See **Interior windowsill**.

Window trough: For a typical double-hung window, the portion of the exterior windowsill between the interior windowsill (or stool) and the frame of the storm window. If there is no storm window, the window trough is the area that receives both the upper and lower window sashes when they are both lowered. Sometimes inaccurately called the window "well".

Worker: An individual who has completed training in an accredited program to perform lead-based paint hazard control in housing.

Worksite: Any interior or exterior area where lead-based paint hazard control work takes place.

XRF analyzer: An instrument that determines lead concentration in milligrams per square centimeter (mg/cm³) using the principle of x-ray fluorescence (XRF). Two types of field portable XRF analyzers are used – direct readers and spectrum analyzers. For this lead-based paint inspection, the term XRF analyzer only refers to portable instruments manufactured to analyze paint, that have a HUD Performance Characteristic Sheet, and are interpreted in accordance with the Performance Characteristic Sheet. It does not refer here to laboratory-grade units or portable instruments designed to analyze soil.

XII. Laboratory Results



#24034702

Analysis Report prepared for

DK Environmental & Construction Services, Inc.

8786 Sonoma Coast Drive
Winter Garden, FL 34787

Phone: (814) 243-1927

1010 SW 5th St
Ocala, FL 34471

Collected: **August 13, 2024**
Received: **August 15, 2024**
Reported: **August 16, 2024**

We would like to thank you for trusting Hayes Microbial for your analytical needs!
We received 1 samples by UPS in good condition for this project on August 15th, 2024.

The results in this analysis pertain only to this job, collected on the stated date, and should not be used in the interpretation of any other job. Information supplied by the customer can affect the validity of results. These results apply only to the samples as received. This report may not be duplicated, except in full, without the written consent of Hayes Microbial Consulting, LLC.

All information provided to Hayes Microbial is confidential information relating to our customers and their clients. We will not disclose, copy, or distribute any information verbally or written, except to those designated by the customer(s). We take confidentiality very seriously. No changes to the distribution list will be made without the express consent of the customer.

This laboratory bears no responsibility for sample collection activities, analytical method limitations, or your use of the test results. Interpretation and use of test results are your responsibility. Any reference to health effects or interpretation of mold levels is strictly the opinion of Hayes Microbial. In no event, shall Hayes Microbial or any of its employees be liable for lost profits or any special, incidental or consequential damages arising out of the use of these test results.

Steve Hayes, BSMT (ASCP)
Laboratory Director
Hayes Microbial Consulting, LLC.



EPA Laboratory ID: VA01419



Lab ID: #188863



DPH License: #PH-0198

#	Sample	Weight (mg)	Concentration (% by Weight)	Concentration (PPM)
1	S1 - Composite Drip Edge			<23



Collected: **Aug 13, 2024**

Received: **Aug 15, 2024**

Reported: **Aug 16, 2024**

Project Analyst:
 Brian Keith, *[Signature]*

Date:
08 - 16 - 2024

Reviewed By:
 David McDonald, PHR *[Signature]*

Date:
08 - 16 - 2024

Lead in Air Analysis	The OSHA Action Level for Lead in Air is 30 ug/m ³ . The OSHA Permissible Exposure Limit for an 8 Hour Time Weighted Average is 50ug/m ³ . Sample Results denoted with a "less than" (<) symbol contain less than 2.00ug total lead, based on a 10mL volume.																
Dust Wipe Lead Analysis	The regulatory guidelines for lead dust by wipe sampling are as follows:																
<table border="1"> <thead> <tr> <th>Location</th> <th>EPA Clearance Level</th> <th>EPA Hazard Level</th> <th>New York City DOHMH Standard</th> </tr> </thead> <tbody> <tr> <td>Floors (FL)</td> <td><10.0µg/ft²</td> <td>10.0µg/ft²</td> <td>5.0µg/ft²</td> </tr> <tr> <td>Interior Window Sills (SL)</td> <td><100.0µg/ft²</td> <td>100.0µg/ft²</td> <td>40.0µg/ft²</td> </tr> <tr> <td>Window Wells (WW)</td> <td><400.0µg/ft²</td> <td></td> <td>100.0µg/ft²</td> </tr> </tbody> </table>		Location	EPA Clearance Level	EPA Hazard Level	New York City DOHMH Standard	Floors (FL)	<10.0µg/ft ²	10.0µg/ft ²	5.0µg/ft ²	Interior Window Sills (SL)	<100.0µg/ft ²	100.0µg/ft ²	40.0µg/ft ²	Window Wells (WW)	<400.0µg/ft ²		100.0µg/ft ²
Location	EPA Clearance Level	EPA Hazard Level	New York City DOHMH Standard														
Floors (FL)	<10.0µg/ft ²	10.0µg/ft ²	5.0µg/ft ²														
Interior Window Sills (SL)	<100.0µg/ft ²	100.0µg/ft ²	40.0µg/ft ²														
Window Wells (WW)	<400.0µg/ft ²		100.0µg/ft ²														
The Reporting Limit is 10.00µg Total Pb. Reported results are not corrected for field blanks. Dust wipe area and results are calculated based on area measurements determined by the client.																	
Paint Chip Lead Analysis	The HUD lead guidelines for lead paint chips are 0.50% by weight, 5000 ppm, or 1.0mg/cm ² . The Reporting Limit is 10µg Total Pb.																
Water Lead Analysis	Minimum Reporting Limit: 0.001mg/L (1ppb) lead concentration. EPA Regulatory Limit: 0.015mg/L (15ppb).																
Soil Lead Analysis	The Federal lead guidelines for lead in soil is 400µg/g (ppm) in play areas, and 1200 µg/g (ppm) in bare soil in the remainder of the yard. The Reporting Limit is 10.0 µg Total Pb.																

DK ENVIRONMENTAL & CONSTRUCTION SERVICES, INC.

•8786 Sonoma Coast Drive, Winter Garden, FL 34787

•407-614-4572

•814-243-1927

•dkenvironmental@yahoo.com

Chain of Custody

Client: DK Environmental
8786 Sonoma Coast Drive
Winter Garden, FL 34787

Project Name: 1010 SW 5th St.
Osaka, FL 34471
Project No.: _____

Office Phone: 407-614-4572

Contact 1: Debra Koontz

Cell Phone: 814-243-1927

Contact 2: _____

Email: dkenvironmental@yahoo.com

Special _____

Instructions: _____

N

SHIP: UPS - SD
DATE: 08-15-2024

METALS



24034702

1415 1031 8217 390



Matrix:

- | | | | |
|--------------------------------|--|--|--------------------------------|
| <input type="checkbox"/> Air | <input checked="" type="checkbox"/> Soil | <input type="checkbox"/> Bulk | <input type="checkbox"/> Other |
| <input type="checkbox"/> Water | <input type="checkbox"/> Paint | <input type="checkbox"/> Surface Dust/Wipe | |

Analysis Method:

- | | | |
|--|--|--|
| <input type="checkbox"/> PCM : NIOSH 7400 | <input type="checkbox"/> PLM : Bulk Asbestos EPA 600 | <input type="checkbox"/> TEM : AHERA |
| <input type="checkbox"/> PCM : OSHA | <input type="checkbox"/> PLM : Point Counting 198.1 | <input type="checkbox"/> TEM : NIOSH 7402 |
| <input type="checkbox"/> PCM : TWA | <input type="checkbox"/> PLM : NOB via 198.1 (PLM only) | <input type="checkbox"/> TEM : Dust / Wipe |
| <input type="checkbox"/> AAS : Lead in Air | <input type="checkbox"/> If <1% by PLM, to TEM via 198.4 | <input type="checkbox"/> TEM : Dust / Microvac |
| <input type="checkbox"/> AAS : Lead in Water | <input type="checkbox"/> PLM: See page 2 for instructions | <input type="checkbox"/> TEM : NOB 198.4 |
| <input type="checkbox"/> AAS : Lead in Paint | See Page 4 for Mold Specific Log | <input type="checkbox"/> TEM : Bulk Analysis |
| <input type="checkbox"/> AAS : Lead Dust/Wipe | <input type="checkbox"/> IAQ: I Bioaersol Fungal Spore Trap | <input type="checkbox"/> TEM : Potable Water |
| <input checked="" type="checkbox"/> AAS : Lead in Soil | <input type="checkbox"/> IAQ: II Bioaersol Fungal Spore Trap | <input type="checkbox"/> TEM : Non-Potable Water |
| <input type="checkbox"/> AAS : TCLP | <input type="checkbox"/> IAQ: Tape, Bulk, Misc. Qualitative | <input type="checkbox"/> TEM : Other |
| <input type="checkbox"/> AAS : Metals (Cd, Zn, Cr) | <input type="checkbox"/> IAQ: Tape, Bulk, Misc. Quantitative | <input type="checkbox"/> TEM : Dust : NIOSH 0500 |
| | <input type="checkbox"/> IAQ: Other Culturable ID | <input type="checkbox"/> TEM : Dust : NIOSH 0600 |

Turnaround Time:

Preliminary Results Requested By: _____ Verbals FAX Email

date/time

- 10 Day 5 Day 3 Day 2 Day 1 Day 12 Hour 6 Hour RUSH

Sample Numbers:

Client #(s): SI - SI Lab #(s): _____ Total: 1

Chain of Custody:

Relinquished (Name / Organization): <u>Debra Koontz</u>	Date: <u>08/13/24</u> Time: <u>11:00 AM</u>
Received by (Name): <u>(Signature)</u>	Date: <u>8/15/24</u> Time: _____
Sample Login (Name): _____	Date: _____ Time: _____
Analysis (Name(s)): _____	Date: _____ Time: _____
QA/QC Review (Name(s)): _____	Date: _____ Time: _____
Archived/Released: _____ QA/QC InterLAB Use: _____	Date: _____ Time: _____

(Signature) 10fz

DK ENVIRONMENTAL & CONSTRUCTION SERVICES, INC.

•8786 Sonoma Coast Drive, Winter Garden, FL 34787

•407-614-4572

•814-243-1927

•dkenvironmental@yahoo.com

Chain of Custody - Sample Log

Project: 1010 SW 5th St., Ocala, FL 34471

Client Sample #	Lab #	Location/Description	Air Volume, L Area, in ²	Lab Results
51		Composite drip edge		
			<div data-bbox="836 1507 901 1585">N</div> <div data-bbox="950 1503 1136 1558">SHIP: UPS - SD DATE: 08-15-2024</div> <div data-bbox="941 1602 1153 1627">1415 1031 8217 390</div> 	<div data-bbox="1388 1516 1477 1537">METALS</div>  <div data-bbox="1347 1644 1507 1675">24034702</div>
			jm	20/2